Ramping12x18x02.doc

Ramping RHIC Power Supplies (as of 12/18/02) – One Hysterisis cycle.

- 1. Make sure that both the Blue and Yellow Links are up.
- 2. Go to the Pet Tree and select RHIC>MAGNETS>WFGMAN.
- 3. Press the INIT WFGs button and press return.
- 4. Press the LOAD SATURATION button and press return.
- 5. Press the LOAD LIMITS button and press return.
- 6. Adjust the slow factor to 3 and press return.
- 7. Click on the AUXRAMP button and select "HERE TO PARK" and press return.
- 8. After you reach PARK change the slow factor to 6 and press return.
- 9. Click on the AUXRAMP button and select "HERE TO FIRST" and press return. FIRST means INJECTION.
- 10. After you reach Injection, change the slow factor to 1 and press return.
- 11. Now go to the MAIN RAMP button and select EXECUTE and press return. EXECUTE will send you to TOP ENERGY
- 12. Once you reach TOP ENERGY change the slow factor to 2 and press return.
- 13. Click on the AUXRAMP button and select "HERE TO FIRST" and press return
- 14. After you reach Injection, change the slow factor to 6 and press return.
- 15. Click on the AUXRAMP button and select "HERE TO PARK" and press return.